WIRING INSTRUCTIONS

TITLE

SANDER

MILWAUKEE ELECTRIC TOOL CORP. 13135 WEST LISBON RD. BROOKFIELD, WIS.

DATE
Mar. '99

BULLETIN
58-01-0313

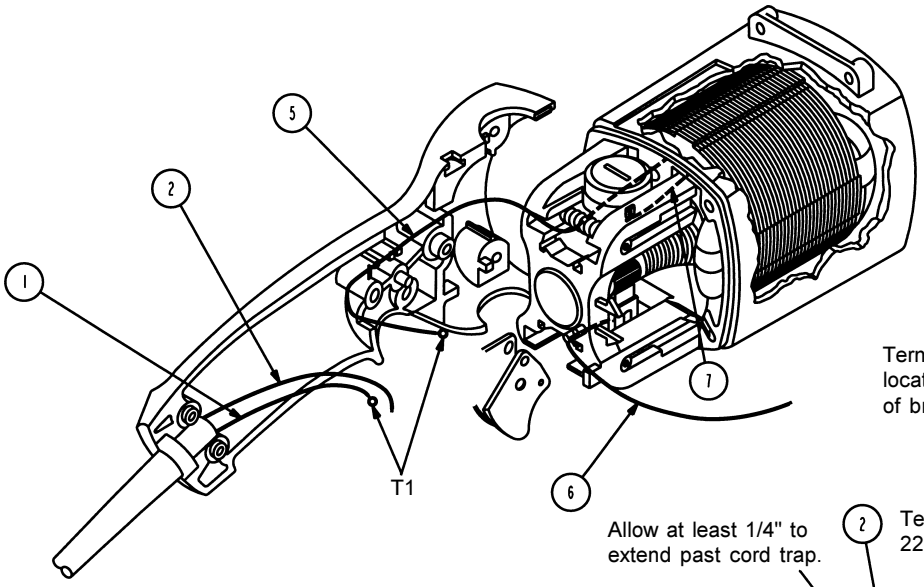

NOTE:
As an aid in reassembly, take note of wire routing and position in wire guides and traps while dismantling tool.

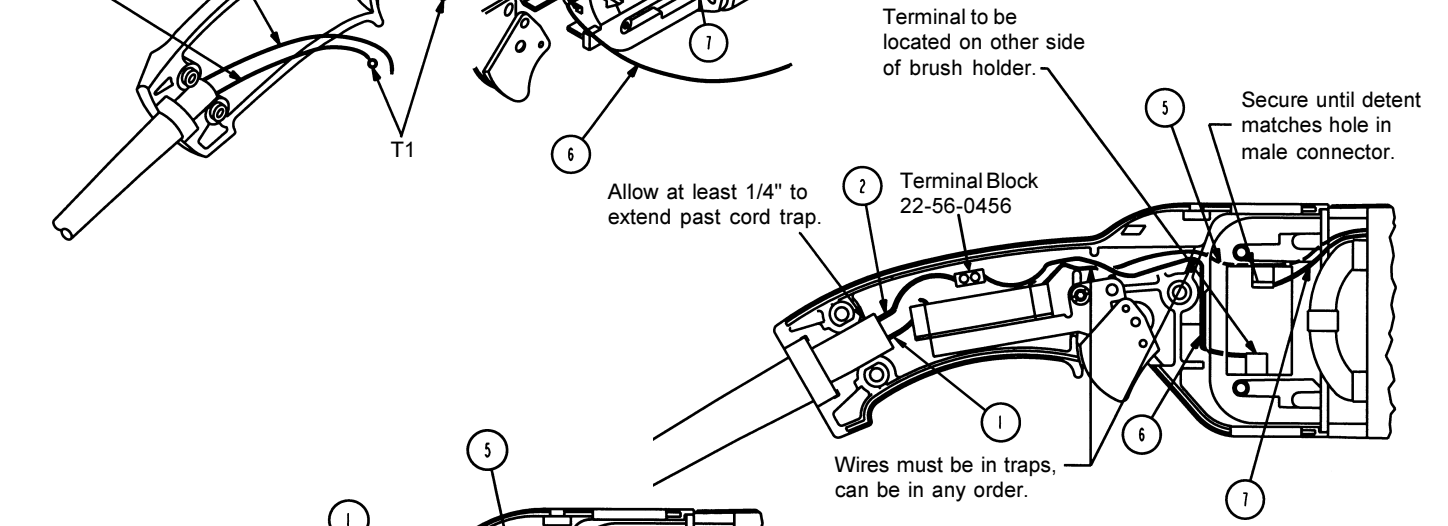

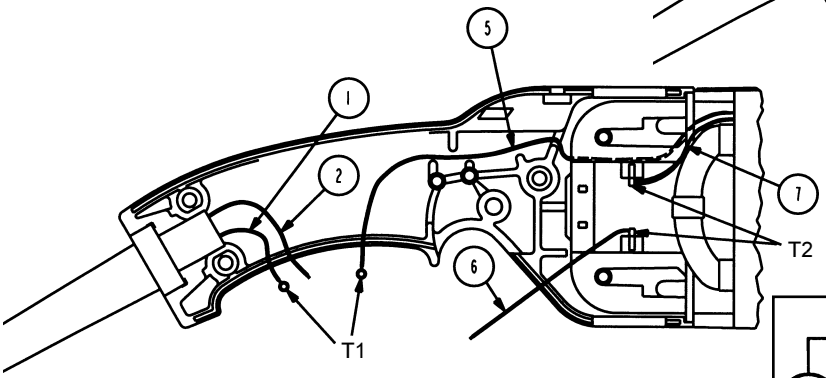

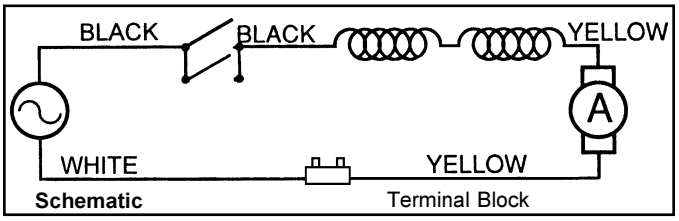

WIRING SPECIFICATIONS					
Wire No.	Wire Color	Origin or Part No.	Gauge	Length	Terminals, Connectors and End Wire Preparation
1	Black	Cord	16	1-1/2"	Strip 3/16" for T1
2	White	Cord	16	1-1/2"	Strip 3/16" and tin for C1
5	Blk/Bl	Field	16	7"	Strip 3/16" for T1
6	Yellow	Brush	16	8"	Strip 3/16" and tin for C1
					Strip 1/8" for T2
7	Yel/Rd	Field	16	1-3/4"	Strip 1/8" for T2
BULK LEAD WIRE - BULLETIN 58-01-0003					

NOTE:
All lead lengths are before stripping.
All field leads are to be measured from and perpendicular to laminations.
All leads must be held to ± 1/8" unless specified elsewhere.

TERMINAL DESCRIPTION		
Code	Part No.	Qty.
T1	23-74-0840	2
T2	23-74-0755	2

CONNECTOR DESCRIPTION		
Code	Part No.	Qty.
C1	22-56-0456	1

Drwg. 1